

**Introduction** When receiving customer complaints to repair the lighter or lighter socket, please carefully investigate the cause of the failure to prevent further occurrences. If the customer uses the wrong size lighter element or power accessory plug, damage may occur to the lighter socket. When applicable, instruct the customer to replace the lighter element with original equipment components or to use an appropriate sized accessory plug. Dimensional information included within this document will instruct you on component specifications.

result in an open fuse.

Service

ice 1. Determine if the lighter is original equipment by using the specifications shown.


Procedure

- a. If the vehicle has a non-genuine lighter element, it has the possibility to cause a short circuit between the lighter element and the lighter socket, which can
  - b. A non-genuine lighter element may cause a rattle or bend the socket bimetal contacts.
  - c. If a non-genuine lighter element is being used, advise the customer to use an original equipment element.

TYPE	DRAWING WITH DIMESIONS	FEATURES	
Genuine	Knob 8.4 mm (0.33") Bimetal 22.5 (0.88") Ash Heater Element Heater Head	No Problem to use.	
Non–Genuine	13 mm (0.51") 13 mm (0.51") 15 mm	Too long an ash guard will contact bimetal (positive circuit) plate and cause fuse to melt.	
	11 mm (0.43") 11 mm (0.43") 11 mm (0.43") 24 mm (0.94")	Excessive free play on the heater head which allows contact between heater element, socket body and bimetal plate, will cause fuse to melt.	



- Service 2. If the lighter element is original
- Procedure (Continued)
- equipment and the lighter socket is bent or pulled out of the dash, please ask the customer about the accessory plug being used in the lighter socket.
  - a. The attached specifications in the drawing provide the maximum recommended size of accessory plug. If the customer is using an accessory plug larger than recommended, please advise the customer to use a plug of appropriate size.
  - b. Using a power plug larger than the given dimensions may damage the lighter socket.
  - c. If the vehicle has a power point socket, advise the customer to use this socket instead of the lighter socket.

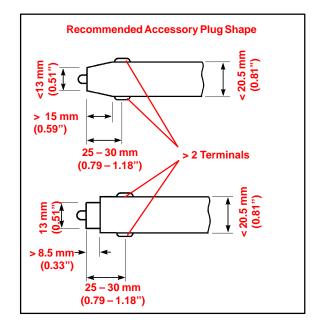

Affected	٠	All models, all model years
Vehicles		, j

Warranty Information	OP CODE	DESCRIPTION	TIME	OPN	T1	T2
	N/A	Not Applicable to Warranty	-	_	-	—