

Introduction On some ECHO, Scion xA, and Scion xB vehicles, a condition may exist that allows the evaporator drain hose to become detached, causing the passenger foot well to become wet. This bulletin provides a procedure to correct this condition.

- Applicable Vehicles**
- **2003 – 2005** model year **ECHO** vehicles produced **BEFORE** the Production Change Effective VIN shown below.
 - **2004 – 2006** model year **Scion xA** and **xB** vehicles produced **BEFORE** the Production Change Effective VINs shown below.

Production Change Information

MODEL	PRODUCTION CHANGE EFFECTIVE VIN
ECHO	JTDBT1#3#50394522
Scion xA	JTKKT6#4#60131993
Scion xB	JTLKT3#4#64033143

Parts Information

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
N/A	88899-52150	Clamp, Cooler, No. 3	1

Warranty Information

OP CODE	DESCRIPTION	TIME	OFF	T1	T2
AC5004	Cooler Clamp Install	0.5	88501-52080	64	55

Applicable Warranty*:


This repair is covered under the Toyota Comprehensive Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.

* Warranty application is limited to correction of a problem based upon a customer's specific complaint.




**Repair
Procedure**


1. Inspect the evaporator drain hose to ensure that it is the cause of the water leak. If the evaporator hose is out of position, continue with this procedure.

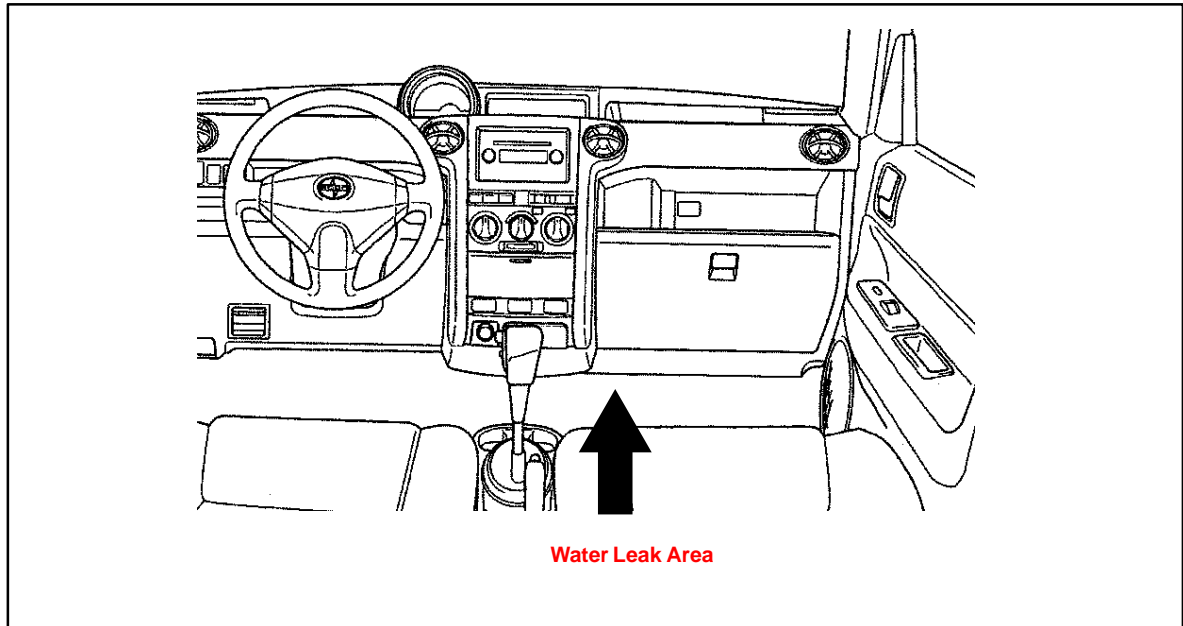

2. Install the retaining clamp on the drain hose.

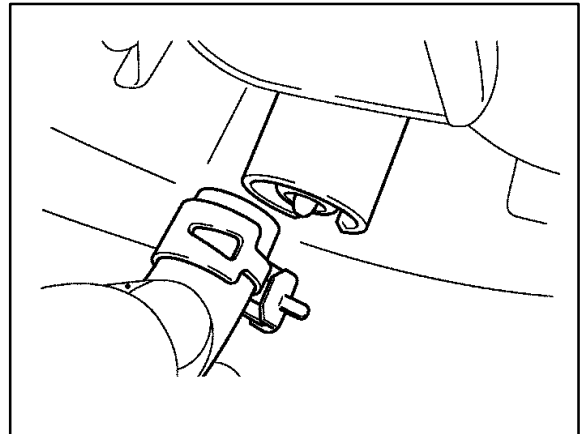

3. Push the drain hose up onto the evaporator drain tube. Ensure that the drain hose is up far enough for the retaining clamp to fully engage the tube.

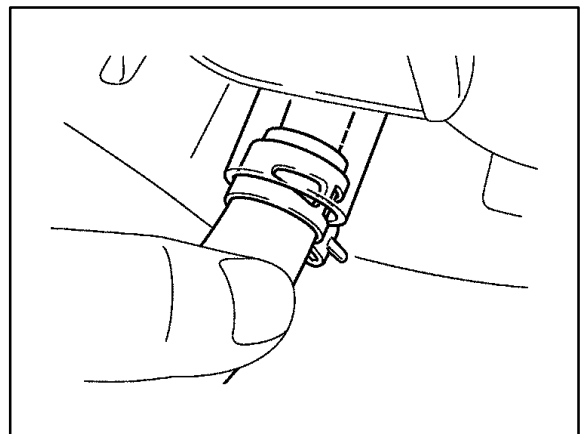

**Repair
Procedure**
(Continued)

4. Release the holding clip.

